



Instruction Manual
377 NCC-A/HTC-A Robotic Curved
Revised 08/2014

D/F MACHINE SPECIALTIES, INC.

MIG & TIG Welding Products, Consumables & Accessories

1750 Howard Drive, North Mankato, MN 56003

Phone: (507) 625-6200 Fax: (507) 625-6203

Email: sales@dfmachinespecialties.com

www.dfmachinespecialties.com

WATER-COOLED CURVED MIG GUN

Model NCC-A (Slip-In Tip) & Model HTC-A (Threaded Tip)
Series A High Capacity



INSTRUCTION, PARTS & SPECIFICATIONS MANUAL

D/F MACHINE SPECIALTIES is a world leader in the design, development, and manufacture of “MIG” (GMAW) & “TIG” (GTAW) welding products, consumables and accessories. D/F offers several types of manual Air or Water-Cooled “MIG” welding tools, and with the increased use of automated and robotic welding systems, a demand has been created for welding tools of the highest quality, durability and interchangeability. For over forty years, D/F welding products have been used extensively on “MIG” and “TIG” welding applications. This experience, coupled with patented design features, unavailable on any other competitive equipment, has made D/F welding tools the most advanced “MIG” and “TIG” welding guns and barrels for semi-automatic, automatic or robotic welding applications.

This Catalog is a guide to helping you select the proper tool for a given semi-automatic, automatic or robotic welding application. The following is only a partial listing of available semi-automatic, automatic and robotic guns. For further information on special “MIG” and “TIG” requirements, please consult the factory.

Customer satisfaction and customer benefits are the center points of all strategic contents

The spirit of the D/F Machine Specialties personnel is to listen to and to integrate the customer throughout the process, to develop and design marketable products, to present prototypes, to carry out pilot tests and to prepare for and be open to new technology and tasks. We attract and carefully select talented individuals who share our values. Together we will nurture and sustain a work environment with two-way communication, training, mentoring, and rewarding career opportunities.

Innovation and quality

Innovation and quality come from being receptive and willing to learn from others. We encourage our people to be creative and take risks in the pursuit of excellence. Innovative practices are deeply rooted in every one of our employees, a philosophy that leads to continuous product development and industry firsts.

Progress

By remaining confident, focused, and persistent in challenging times, we will discover opportunity. Commitment to quality and the pursuit on innovation ensure that D/F Machine Specialties will remain an industry leader for years to come.

Commitment to excellence

At D/F Machine Specialties we commit to design, build and deliver premium products and superior customer support to quality driven welding professionals. Customers still to this day choose D/F over competitors because of our responsiveness and flexibility. Customers will continue to choose D/F tomorrow for our superior hand-made products and service. To ensure this, we need creative and competent personnel in all business divisions, an intensive exchange of thoughts and ideas with all users, participation in working and study groups within the field of welding technology and intensive cooperation with institutes and universities.

Teamwork

Striving for excellence is a commitment that is an integral component of the D/F Culture. Our team of skilled and dedicated employees takes pride in the excellence products they produce. Each of us willingly accepts personal responsibility for meeting our commitments and we hold each other to a high standard of accountability.

Responsibility

We will continually strive to be environmentally responsible and to support the health and safety of our employees, customers, and neighbors. We continue to support the communities in which we operate and the industries in which we participate.

Thank You for Choosing D/F Machine Specialties



TABLE OF CONTENTS

Safety4

Introduction, (Table 1) Recommended Spare Parts, (Table 2) Gas Nozzles5

(Table 3) Ordering Information.....6

Disassembly, Assembly7

Required Tools List for Disassembly & Assembly.....8-9

How Do I Cut, Fit, and Install a New Liner?.....10

What is the Proper Use of the Nozzle Thread Chaser Tap?.....11

(Table 4) Current Tips, (Table 5) Body Liners12

Model NCC-A Water Cooled Curved MIG Gun - Parts.....13

Model HTC-A Water Cooled Curved MIG Gun - Parts14

(Table 6) Liners, (Table 7) Casings.....15

Utility Station.....16

Wire Feeder Adapters.....17

Troubleshooting18-21

SAFETY MEASURES - **PLEASE READ!**

Welding is not particularly hazardous when certain safety practices are followed. Anyone using this equipment should be thoroughly trained in safe welding practices. Failure to observe safe practices may cause serious injury. Handling welding torches presents no danger if the appropriate safety regulations are strictly adhered to. For example:

- Starting-up procedures must be reserved for those fully conversant with processes relating to arc welding equipment.
- Arc welding can prove damaging to eyes, skin, and hearing! It is therefore imperative that the Accident Prevention Regulations UVV 26.0 and VGB 15 are fully observed and that all protective clothing, eye and ear protectors specified are worn.
- The load data given are maximum limit figures. Overloading will inevitably damage the torch!
- Before changing wear parts, disconnect for the power supply.
- The operating instructions for the individual welding components - e.g. power source, wire feed and cooling unit must be followed.
- Never pull the cable assembly across sharp edges or set down close to weld spatter or on a hot workpiece.
- Those not involved in the welding process should be protected by curtains or partitions from radiation and the danger of being dazzled.
- When handling gas cylinders, consult the instructions issued by the manufacturers and the suppliers of the pressurized gas.
- Workpieces which have been degreased using chlorinated solvents must be sprayed down with clean water before welding starts to avoid the risk of phosgene forming. For the same reason, no degreasing baths containing chlorine must be placed close to the welding point.
- All vapors given off by metals can cause harm and a special warning is attached to lead, cadmium, copper, zinc, and beryllium. If necessary, take appropriate precautions (by providing adequate ventilation or an extraction system) to ensure that the legal maximum levels of toxic concentrations are not exceeded.

For more information, refer to the following standards in their latest revisions and comply as applicable.

- ANSI Standard Z49.1, SAFETY IN WELDING AND CUTTING obtainable from the American Welding Society, 2501 N.W. 7th St., Miami, FL 33125.
- ANSI Standard Z41.1, STANDARD FOR MEN'S SAFETY - TOE FOOTWEAR obtainable from the American National Standards Institute, 1430 Broadway, New York, NY 10018.
- ANSI Standard Z49.2, FIRE PREVENTION IN THE USE OF CUTTING AND WELDING PROCESSES obtainable from the American National Standards Institute, 1430 Broadway, New York, NY 10018.
- OSHA, SAFETY AND HEALTH STANDARDS, 29CFR 1910, obtainable from the U.S. Government Printing Office, Washington, D.C. 20402.
- AWS Standard A6.0, WELDING AND CUTTING CONTAINERS WHICH HAVE HELD COMBUSTIBLES obtainable from the American Welding Society, 2501 N.W. 7th St., Miami, FL 33125.
- NFPA Standard 70-1978, NATIONAL ELECTRICAL CODE obtainable from the National Fire Protection Association, 470 Atlantic Avenue, Boston, MA 02210.
- ANSI Standard Z88.2, "Practice for Respiratory Protection" obtainable from the American National Standards Institute, 1430 Broadway, New York, NY 10018.
- ANSI Standard Z87.1, SAFE PRACTICES FOR OCCUPATION AND EDUCATIONAL EYE AND FACE PROTECTION obtainable from the American National Standards Institute, 1430 Broadway, New York, NY, 10018.
- NIOSH, SAFETY AND HEALTH IN ARC WELDING AND GAS WELDING AND CUTTING obtainable from the Superintendent of Documents, U.S. Printing Office, Washington, D.C. 20402.
- American Welding Society Standard AWSF4.1 "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", obtainable from the American Welding Society, 2501 N.W. 7th St., Miami, FL 33125.

IMPORTANT

The D/F torch is famous for the fact that if it is chilled properly, the welder can grab the front of the torch with their bare hand and it will be cold to the touch seconds after welding. With the proper chiller, this can be done even after a 4 hour arc time.

Make certain the cooling water supply is at least the minimum flow rate of 3 quarts per minute (for each inner body), at 40 psi (80 psi maximum) with a 5 gallon reservoir and 15,000 BTU/hr cooling capacity. Gun ratings are affected by shielding gas used, arc time, cooling time and inlet water temperature. Water outlet temperature should not exceed 27°C (80°F). The torch's water out & power cable is not cooled until the coolant has gone through the torch and out the water out & power cable. If water is not flowing through the D/F torch for at least 1 minute prior to striking an arc, when you apply the power and water hits the "hot" water/out & power cable, you will generate steam. Steam can damage the torches internals in seconds causing a leak. It can also blow out the torches water/out & power cable. A flow switch can be installed after the return line ensuring that coolant is present at the return line prior to striking an arc.

When High-Deposition GMAW or extended periods of arc time are used, it is recommended that a liquid chiller be considered with a larger reservoir and a minimum of 30,000 BTU/hr cooling capacity. Precise temperature control maintains the cooling at a constant 13°C (55°F) temperature, thus prolonging the life of the welding equipment and more specifically extending the service life of the gas nozzle and current tip.

A refrigerated liquid chiller for GMAW may be obtained from:

For single torch chillers: Dynaflux - 800-334-4420 - www.dynaflux.com

For multiple torch cooling systems: Koolant Koolers - 800-968-5665 - www.koolantkoolers.com

INTRODUCTION

This instruction manual covers the D/F water cooled curved welding gun models NCC-A & HTC-A, which offer a rugged design for MIG welding with wires ranging from .030"-3/32" for hard/cored wire, and 3/64"-3/32" aluminum wire.

All D/F water cooled guns, whether they be of the pistol or curved type, have the feature of interchangeability from slip-in tips to threaded tips by changing the gun inner body adapter. In addition, the Series A high capacity water cooled nozzle lengths of short A3" & intermediate A4" are available to meet job requirements.

The model NCC-A water cooled curved gun has a current capacity of 450 amperes, 100% duty cycle with Argon shielding. The model HTC-A water cooled curved gun has a current capacity of 600 amperes, 100% duty cycle with CO₂ shielding and 500 amperes, 100% duty cycle in Argon shielding.

These tools are designed to reduce maintenance and to reduce parts inventory. All service lines are connected internally to the gun's inner body and exit the rear of the handle. The unique feature of these curved water cooled welding guns is that the nozzle assembly water chamber and inner body water chamber are serially connected to each other with sliding removable connectors making it a relatively simple matter to detach the nozzle assembly. Thus the need for gaskets or o-rings in the water passage system is completely eliminated.

For further information or help with D/F Machine Specialties products, please visit our web site at www.dfmachinespecialties.com, or consult the factory at 1-507-625-6200.

TABLE 1 - RECOMMENDED SPARE PARTS

ITEM	CODE NO.	MIN QTY.
Gas Nozzle	To Be Selected	2
Current Tip	To Be Selected	25
Collet Nut	To Be Selected	1
Spatter Disc	18253	2
Body Liner	To Be Selected	2
Insulation Tube	To Be Selected	1

TABLE 2 - GAS NOZZLES

Gun Model	Ref.	Nozzle Type	O.D.	I.D.	Code No.
NC/HT	1	Copper Short Taper	1-3/8"	11/16"	16749
		Copper Short Taper	1-3/8"	13/16"	16750
		Copper Short Taper	1-3/8"	15/16"	16751
	2	Copper Full Taper	1-3/8"	11/16"	18030
		Copper Full Taper	1-3/8"	13/16"	18031
		Copper Full Taper	1-3/8"	15/16"	18032

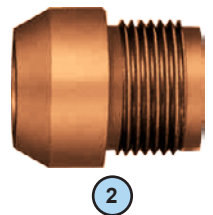
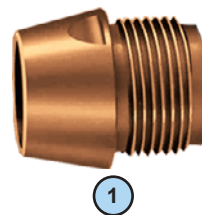


TABLE 3 - ORDERING INFORMATION

Model NCC-A (Slip-In Tip)

CODE NO.	DESCRIPTION	WITH NOZZLE ASSEMBLY	CURRENT TIP		WIRE RANGE	ARGON (AMPS)	CO ₂ (AMPS)	MODEL NO.	OVERALL LENGTH
			LENGTH	FASTENING METHOD					
11694	5 Ft. Assembly	11142 (Short)	4"	Collet Nut	.030"-3/32" Hard/Cored	500	600	NCC-A94	13.750"
11699	5 Ft. Assembly	11138 (Inter.)	4"	Collet Nut	3/64"-3/32" AL	500	600	NCC-A99	14.750"
11697	6 Ft. Assembly	11142 (Short)	4"	Collet Nut	.030"-3/32" Hard/Cored	500	600	NCC-A97	13.750"
11701	6 Ft. Assembly	11138 (Inter.)	4"	Collet Nut	3/64"-3/32" AL	500	600	NCC-A01	14.750"
11481	7 Ft. Assembly	11142 (Short)	4"	Collet Nut	.030"-3/32" Hard/Cored	500	600	NCC-A81	13.750"
11491	7 Ft. Assembly	11138 (Inter.)	4"	Collet Nut	3/64"-3/32" AL	500	600	NCC-A91	14.750"
11482	8 Ft. Assembly	11142 (Short)	4"	Collet Nut	.030"-3/32" Hard/Cored	500	600	NCC-A82	13.750"
11492	8 Ft. Assembly	11138 (Inter.)	4"	Collet Nut	3/64"-3/32" AL	500	600	NCC-A92	14.750"
11483	10 Ft. Assembly	11142 (Short)	4"	Collet Nut	.030"-3/32" Hard/Cored	500	600	NCC-A83	13.750"
11493	10 Ft. Assembly	11138 (Inter.)	4"	Collet Nut	3/64"-3/32" AL	500	600	NCC-A93	14.750"
11484	12 Ft. Assembly	11142 (Short)	4"	Collet Nut	.030"-3/32" Hard/Cored	500	600	NCC-A84	13.750"
11494	12 Ft. Assembly	11138 (Inter.)	4"	Collet Nut	3/64"-3/32" AL	500	600	NCC-A94	14.750"
11485	15 Ft. Assembly	11142 (Short)	4"	Collet Nut	.030"-3/32" Hard/Cored	500	600	NCC-A85	13.750"
11495	15 Ft. Assembly	11138 (Inter.)	4"	Collet Nut	3/64"-3/32" AL	500	600	NCC-A95	14.750"

Model HTC-A (Threaded Tip)

CODE NO.	DESCRIPTION	WITH NOZZLE ASSEMBLY	CURRENT TIP		WIRE RANGE	ARGON (AMPS)	CO ₂ (AMPS)	MODEL NO.	OVERALL LENGTH
			LENGTH	FASTENING METHOD					
11692	5 Ft. Assembly	11142 (Short)	Varies for Hard & Cored	Threaded	.030"-3/32" Hard/Cored	500	600	HTC-A92	13.750"
11693	5 Ft. Assembly	11138 (Inter.)		Threaded	3/64"-3/32" AL	500	600	HTC-A93	14.750"
11696	6 Ft. Assembly	11142 (Short)	Varies for Hard & Cored	Threaded	.030"-3/32" Hard/Cored	500	600	HTC-A96	13.750"
11687	6 Ft. Assembly	11138 (Inter.)		Threaded	3/64"-3/32" AL	500	600	HTC-A87	14.750"
11476	7 Ft. Assembly	11142 (Short)	Varies for Hard & Cored	Threaded	.030"-3/32" Hard/Cored	500	600	HTC-A76	13.750"
11501	7 Ft. Assembly	11138 (Inter.)		Threaded	3/64"-3/32" AL	500	600	HTC-A01	14.750"
11477	8 Ft. Assembly	11142 (Short)	Varies for Hard & Cored	Threaded	.030"-3/32" Hard/Cored	500	600	HTC-A77	13.750"
11502	8 Ft. Assembly	11138 (Inter.)		Threaded	3/64"-3/32" AL	500	600	HTC-A02	14.750"
11478	10 Ft. Assembly	11142 (Short)	Varies for Hard & Cored	Threaded	.030"-3/32" Hard/Cored	500	600	HTC-A78	13.750"
11503	10 Ft. Assembly	11138 (Inter.)		Threaded	3/64"-3/32" AL	500	600	HTC-A03	14.750"
11479	12 Ft. Assembly	11142 (Short)	Varies for Hard & Cored	Threaded	.030"-3/32" Hard/Cored	500	600	HTC-A79	13.750"
11504	12 Ft. Assembly	11138 (Inter.)		Threaded	3/64"-3/32" AL	500	600	HTC-A04	14.750"
11480	15 Ft. Assembly	11142 (Short)	Varies for Hard & Cored	Threaded	.030"-3/32" Hard/Cored	500	600	HTC-A80	13.750"
11505	15 Ft. Assembly	11138 (Inter.)		Threaded	3/64"-3/32" AL	500	600	HTC-A05	14.750"

DISASSEMBLY

- 1) When repairs are made on the production line make certain the power source and wire feeder are disconnected from primary power.
- 2) Remove the forward gas nozzle, current tip, support tube and spatter disc.
- 3) Unscrew the elbow nut which permits the water cooled nozzle assembly to be pulled forward approximately 3/4". This will expose the water connection fittings. With a 5/16" open end wrench, disconnect the fittings and remove the water-cooled nozzle assembly from the elbow. If replacement of inner body is required remove adapter with jam nut at this time. Two (2) 1/2" open end wrenches are needed to remove the adapter/jam nut assembly from the inner body. Break the jam nut loose first, and then remove the assembly.
- 4) Loosen the two (2) socket screws in the elbow and pull the fiber tube back far enough to expose the inner body and hose fittings.
- 5) Remove the screw and insulating washer on top of the metal elbow. This will permit the inner body to move forward slightly.
- 6) Remove the two (2) insulators from the concaves.
- 7) At this time remove the black fiber insulator from the elbow. The inner body can now be removed from the rear of the elbow. A slight twisting motion will aid in quick disassembly.


ASSEMBLY

- 1) Load handle with all service lines. The gas line is pressed on and safety wired.
- 2) To assemble the water cooled curved gun connect all service lines to the inner body, including the interconnection hose assembly which attaches to the fitting at rear end of inner body casting. Before connecting a replacement interconnection hose (10974), note position of stainless steel liner within hose assembly. It is most desirable to connect the end of the hose to the inner body water fitting using the end that indicates the spring liner closest to it. In other words, the hose end that indicates the open space within the hose should be the end that is fastened to the water cooled nozzle. The interconnection hose assembly may be bent into a U-shape manually before applying it to the rear of the inner body. Prior to fastening the hose, place it in location between the two pipes extending from the rear of the inner body and place hose in the right concave viewed from the casing socket. Hoses should extend out approximately 1/2" in front of body elbow.
- 3) Hold both interconnection hoses in their relative position and slide inner body into body elbow. Slide the black insulator into position in the body elbow and apply the body flat head screw with insulating washer to the top of the body elbow.
- 4) Insert the two (2) nylon insulating tubes over the hoses extending from the front of the elbow assembly.
- 5) Apply the current tip adapter.
- 6) The nylon collar should be in place on the rear of the water cooled nozzle assembly. It is important that the small hole in the nylon collar be on the lower right hand side viewing the nozzle from the rear when the interconnection hoses are fastened. After connecting the interconnection hoses push the water cooled nozzle up against the face of the body elbow. The body nut may now be applied.
- 7) The insulation tube should now be placed in the Water-Cooled Nozzle. With the high capacity water cooled nozzle assemblies, the insulation tube has a shoulder on one end with a smaller ID that must be inserted up into the torch and recess inside the counter-bored collar of the water-cooled nozzle assembly. Next, insert the spatter disc into the Water-Cooled Nozzle with the counter-bored end facing inner body into nozzle, followed by pushing the support tube up into the Water-Cooled Nozzle around current tip adapter. The collet nut will hold the support tube, spatter disc, and insulation tube in the torch. The collet does not have to be removed but only loosened 1/2 turn to 1 full turn to change a slip-in tip. When using a threaded tip, the tip itself holds the support tube and inner parts in place. Please remember that you do not have to remove a gas nozzle to change a tip. For nozzle cleaning with the nozzle thread chaser tap, see p. 11. Always clean and blow out a torch before applying the current tip and gas nozzle.
- 8) Push casing into socket at rear of inner body and tighten socket set screw.
- 9) After making certain all services are tight at rear of inner body, slide the body housing into rear of elbow and tighten the socket screws.

REQUIRED TOOLS LIST FOR DISASSEMBLY & ASSEMBLY

1. **D/F 12111 Collet/Tip Wrench** - This is the only tool that should ever be used to tighten the collet nut or the tip. Pressure should be 30 lbs., or as snug as hand tightened. Never use another wrench to apply more torque to this wrench.
2. **D/F Nozzle Thread Chaser Tap** - This is used to re-tap damaged threads that have been improperly cleaned or cross threaded. Always blow out the nozzle and gas nozzle after changing gas cup or re-tapping. For more information on how to use the nozzle thread chaser tap, use the following link: www.dfmachine.com/taps
3. **Long 5/16" Open Ended Wrench**
 - A. A short wrench will work, however we prefer the feel and comfort of the long 5/16" open ended wrench. This is used to loosen or tighten interconnection hose (10974) to the 7mm fitting on the inner body, and to connect the pipe assembly (10957) to the water in hose.
 - B. Also use this wrench to connect the torch's water-cooled nozzle assembly to the interconnection hoses.
4. **9/16" & 1/2" Open Ended Wrench**
 - A. This is used on the inner body's water out & power cable fitting to secure the water out and power cable to the torch's inner body. A crescent wrench could be used instead, but due to the large size of crescent wrenches, we prefer the smaller size of the open ended wrenches. We prefer the use of the larger wrenches on the power cable fitting to ensure that there are no water leaks, and that it has been seated correctly. You will use the #7 (Long 9/16" Open Ended Wrench) for the fitting on the water out & power cable hose. (see #5 A)
 - B. This wrench is also used to secure the adapter and jam nut that hold the current tip to the inner body. In your left hand hold the inner body, and with your right hand thread up the adapter using the 1/2" Open Ended Wrench until it is tight. Now place the same wrench on the jam nut and snug it up against the inner body. Keeping that wrench on the jam nut and placing it on the table for force, take #7 (Long 1/2" Open Ended Wrench), place it on the adapter and push it down (counter-clockwise) securing the adapter to the inner body. (see #5 B)
5. **Long 1/2" & 9/16" Open Ended Wrench**
 - A. This is used to secure the water out & power cable to the torch's inner body. A medium size adjustable crescent wrench could be used as well. We prefer the use of the larger wrenches on the power cable fitting to ensure that there are no water leaks, and that it has been seated correctly. (see #4 A)
 - B. This wrench is also used to secure the adapter and jam nut to the inner body. (see #4 B)
6. **Adjustable Crescent Wrench** - A medium size adjustable crescent wrench could be used as well. We prefer the use of the larger wrenches on the power cable fitting to ensure that there are no water leaks, and that it has been seated correctly. **CAUTION:** Never use excessive force with large wrenches, for you could twist or break parts.
7. **Standard Flat Head Screwdriver** - This is used to tighten or secure the torch's body screw. Also, the screwdriver can be used to straighten the contact tip if it is not aligned in the center of the gas cup or water-cooled nozzle **CAUTION:** This cannot be done unless the spatter disc has been removed from the torch.
8. **Long Nose Pliers** - These are used to grab the small white insulation tubes (10723) and get them into the correct position when working on the interconnection hose fittings inside the torch. Also they are very handy when changing a slip-in contact tip.
9. **3/32" Allen Wrench** - This is used to secure the socket set screw that holds the casing/conduit in the inner body.
10. **7/64" Allen Wrench** - This is used to secure the 2 socket screws that hold the elbow on the body housing.

REQUIRED TOOLS LIST FOR DISASSEMBLY & ASSEMBLY

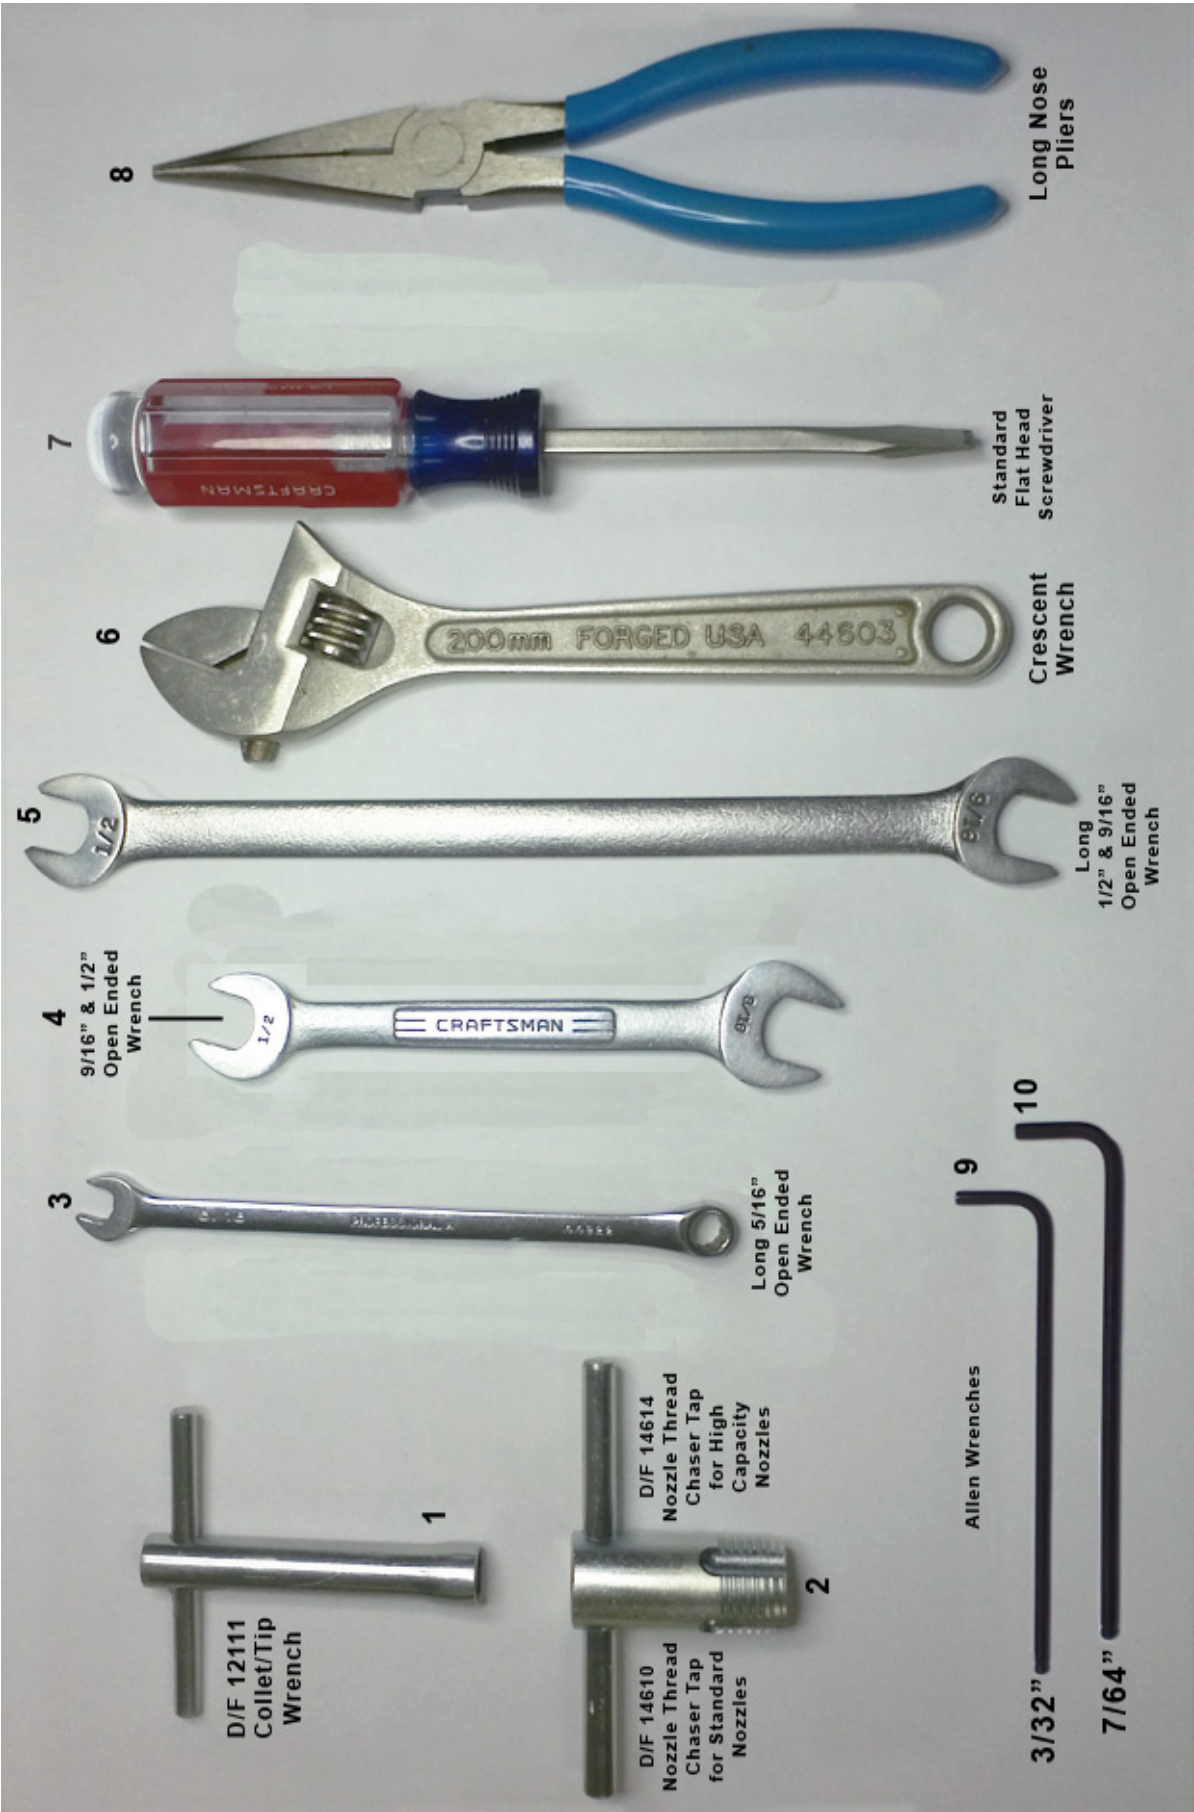

HOW DO I CUT, FIT, AND INSTALL A NEW LINER?

1. Be sure the MIG Gun cable is arranged in a straight line, free from twists, when installing or removing a wire liner.
2. Remove the old liner by first removing the MIG gun's contact tip.
3. Pull the old wire liner out of the conduit/casing assembly from the feeder connector or feeder adapter plug end. If you are using a feeder adapter that has an inlet, the inlet must be removed first. If you have any problems removing the liner you may un-thread the feeder adapter first this will also back the liner out of the conduit/casing.
4. If you know that the old liner is the correct length or is still the original liner that was cut at the factory you may hold the new liner up against the old liner and cut off the new liner to the same size as the old liner.
5. Make sure you have a good sharp cut off with no material sticking out!
6. To get the correct length of the new liner, insert the liner into the feeder adapter and feed it through the conduit/casing.
7. Once again be sure the MIG Gun cable is arranged in a straight line, free from twists, when installing a new wire liner.
8. Sometimes on longer conduits/casings and liners it may take 2 people together; one on each end to rotate and twist the conduit/casing to get the liner through the torch.
9. If you have any troubles getting a liner through a torch make sure you have a good sharp cut off, and if you have to you can gently sand the end of the liner on a belt sander. You can remove the cast in the aluminum liner by pre-bending and straightening the liner before loading.
10. After the new liner comes out the end of the torch you want to cut the new liner off flush with the end of the copper gas nozzle or Cu gas cup.
11. Now you have the overall length of the liner, you still have to take out the length of the contact tip.
12. Carefully remove the liner one more time.
13. After removing the liner hold the gun end of the liner up against the tip.
14. Cut off the length off the tip plus the set back of the tip (1/8" or 3/8" tip setbacks)
15. Now that you have cut off the length of the tip plus the setback you may install the new liner and it will back up into the back of the tip chamfer.
16. We always recommend checking the condition of the insulation tube in the front of the torch and collet nut that holds the slip-in tip.
17. We always recommend replacing the spatter disc/gas diffuser, contact tip, and nozzle, after installing a new liner.
18. Tighten the flat head set screw in the inner body, or the Allen set screw in the docking spool onto the conduit/casing to prevent backward movement or an unwanted pumping action.

WHAT IS THE PROPER USE OF THE NOZZLE THREAD CHASER TAP?

All D/F Nozzles are hand checked for fit before and after plating, and checked again before shipping. If a nozzle has been installed on a new complete torch, they have also been hand checked while being assembled.

The only reason to ever take a gas cup out a nozzle is to clean it. The nozzle and the gas cup must be blown out, and all of the threads have to be wire brushed and blown out again before hand-tightening the gas cup back into the nozzle. If you can't thread it in by hand then something is wrong. Never force a gas cup into a nozzle.

When using the D/F Machine Specialties nozzle thread chaser taps, be sure to always follow the steps below:

1. Make sure that the nozzle is properly supported when tapping so it does not twist in the front of the torch body and cause damage.
 - Improper support can cause the spigots to twist off the top of the rear nozzle collar, or damage the torch internal body parts.
 - Note where the water ports go down the sides of the water-cooled nozzle (following down in line with the spigots). Too much direct pressure on these water ports could cause them to cave in and block off the flow of water.
 - Best practice is to hold the water-cooled nozzle in a vice with soft jaws, perpendicular to the spigots.
 - Over-tightening of the vice can cause damage in general.
2. Remove the tip from the front of the torch before tapping.
3. Lightly lubricate the nozzle and nozzle thread chaser tap before tapping.
4. Be sure to start the tap very carefully. Do not cross thread the nozzle.
5. Be very careful to start threads correctly. Only tap 1/2 turn at a time, always backing up and removing chips 1/2 cycle at a time before moving forward. Do not try to tap further into the water-cooled nozzle than needed or past the factory thread depth.
6. Blow out the nozzle after tapping. Wire brush and blow off the gas cup before threading it back into the nozzle.
7. If nozzle is badly deformed or damaged please return to the factory for a repair estimate before disposing of product (damaged parts can often be repaired).

ORDERING INFORMATION - NOZZLE THREAD CHASER TAPS

CODE NO.	DESCRIPTION	USED WITH NOZZLE ASSEMBLY	USED FOR GAS NOZZLE
14610	Nozzle Thread Chaser Tap for Standard A/C & W/C Nozzle Assembly Front	13197 16184 11117, 45101 11118, 45102 11119, 45103 45114 45107 NCC-N/HTC-N NCC-LRN, HTC-LRN	10340 10359 10362 10374
14611	Nozzle Thread Chaser Tap for BIG MIG & BIG TIG Nozzle Assembly Front	11123	10382 10387 10389 10390 10392
14612	Nozzle Thread Chaser Tap for Nozzle Body Assembly Rear	13196 13197 13198 16184	
14614	Nozzle Thread Chaser Tap for Series A High-Capacity Nozzle Assembly Front	11142, 45120 11138, 45121 45127 11132, 45129 45125	16748 16749 16750 16751 18030 18031 18032
14615	Nozzle Thread Chaser Tap for Nozzle Body Assembly Front	13198	10379
14617	Nozzle Thread Chaser Tap for Tandem Nozzle Assembly Front	41641	41667 41668

TABLE 4 - CURRENT TIPS

CURRENT TIPS - 5/16" DIAMETER SLIP-IN

Gun/Barrel Model	Wire Size	Wire Type	Code No.
All NC, NCC, NCM (Tip provides 1/8" set back)	.030"	Hard	10883
	.035"	Hard	10884
	.045"	Hard	10885
	.052"	Hard	10886
	1/16"	Hard	10887
	5/64"	Hard	10888
	3/32"	Hard	10889
	7/64"	Hard	10904
All NC, NCC, NCM (Tip provides 3/8" set back)	1/8"	Hard	10933
	.035"	Cored	10893
	.045"	Cored	10894
	.052"	Cored	10895
	1/16"	Cored	10896
	5/64"	Cored	10897
	3/32"	Cored	10898
	7/64"	Cored	10899
All NC, NCC, NCM (Tip provides 1/8" set back)	1/8"	Cored	10900
	3/64"	Soft	10902
	1/16"	Soft	10935
	5/64"	Soft	10888
	3/32"	Soft	10936



CURRENT TIPS - 7/16" DIAMETER THREADED

Gun/Barrel Model	Wire Size	Wire Type	Code No.
All HT, HTC, HTM, CTW, CW-T, MTW (Tip provides 1/8" set back)	.035"	Hard	15116
	.045"	Hard	15117
	.052"	Hard	15121
	1/16"	Hard	15118
	5/64"	Hard	15119
	3/32"	Hard	15120
	7/64"	Hard	15122
	1/8"	Hard	15105
All HT, HTC, HTM, CTW, CW-T, MTW (Tip provides 3/8" set back)	.035"	Cored	15101
	.045"	Cored	15106
	.052"	Cored	15112
	1/16"	Cored	15107
	5/64"	Cored	15108
	3/32"	Cored	15109
	7/64"	Cored	15110
	1/8"	Cored	15111
All HT, HTC, HTM, CTW, CW-T, MTW (Tip provides 1/8" set back)	3/64"	Aluminum	15126
	1/16"	Aluminum	15125
	5/64"	Aluminum	15087
	3/32"	Aluminum	15148
	1/8"	Aluminum	15123



CURRENT TIPS - 1/4" DIAMETER SLIP-IN


Gun/Barrel Model	Wire Size	Wire Type	Code No.
All NC, NCC, NCM (Tip provides 1/8" set back)	.030"	Hard	10787
	.035"	Hard	10788
	.045"	Hard	10789
	.052"	Hard	10830
	1/16"	Hard	10790
	5/64"	Hard	10792
All NC, NCC, NCM (Tip provides 1/8" set back)	3/64"	Aluminum	10781
	1/16"	Aluminum	10782
	5/64"	Aluminum	10823
	3/32"	Aluminum	10783
All NC, NCC, NCM (Bent Tip) (Tip provides 1/8" set back)	.045"	Hard	10562
	.035"	Hard	10565
	3/64"	Aluminum	10572
	1/16"	Aluminum	10573



TABLE 5 - BODY LINERS

WIRE SIZE	WIRE TYPE	CODE NO.
.035"-.045"	Hard/Cored	16318
.045"-1/16"	Hard/Cored	16321
3/64"	Aluminum	17026
1/16"	Aluminum	17027
3/32"	Aluminum	17028
5/64"-7/64"	Cored	16324


WATER-COOLED CURVED GUN - PARTS **MODEL NCC-A (Slip-In Tip)**

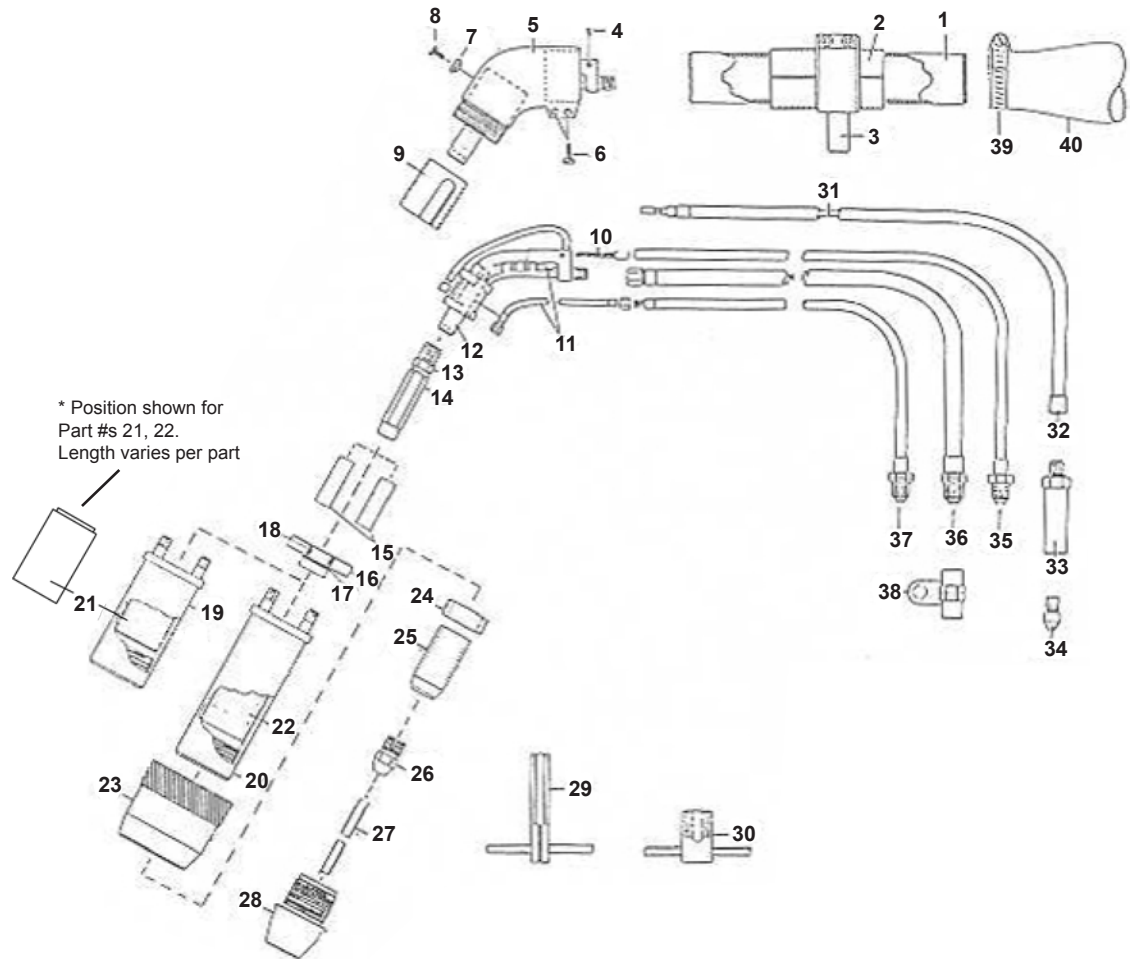

REF.	CODE NO.	DESCRIPTION
1	16744	Body Tube
2	16230	Sleeve
3	14085	Mounting Bracket
4	14712	Socket Screw
5	12885	Body Elbow
6	12521	Socket Screw (2 req'd)
7	12880	Washer
8	12613	Flat Head Screw
9	12892	Elbow Insulator
10		Body Liner (see p. 12, Table 5)
11	10974	Hose Assembly (2 req'd)
12	11035	Inner Body
13	11960	Jam Nut
14	12021	Adapter - 1/4" Slip-In Tip - 3" Short
	12022	Adapter - 1/4" Slip-In Tip - 4" Inter.
		Adapter - 5/16" Slip-In Tip - 4" Inter.
15	10723	Insulation Tube (2 req'd)
16	18070	Collar w/ O-rings
17	12516	O-ring (External)
18	13912	O-ring (Internal)
19	11142	Water-Cooled Nozzle A3"
20	11138	Water-Cooled Nozzle A4"

REF.	CODE NO.	DESCRIPTION
21	18451	Insulation Tube - 3" Short
22	18452	Insulation Tube - 4" Inter.
23	16812	Nut
24	18253	Spatter Disc
25	18251	Support Tube - 3" Short
	18252	Support Tube - 4" Inter.
26	11950	Collet Nut - 1/4" Slip-In Tip
	18262	Collet Nut - 5/16" Slip-In Tip
27		Current Tip - Slip-In (see p. 12, Table 4)
28		Gas Nozzle (see p. 5, Table 2)
29	12111	Wrench
30	14614	Nozzle Thread Chaser Tap
31		Liner (see p. 15, Table 6)
32		Casing (see p. 15, Table 7)
33		Wire Feeder Adapter (see p. 17)
34		Inlet (see p. 17)
35		Gas Hose (see p. 15, Table 8)
36		Water Out & Power Cable (see p. 15, Table 8)
37		Water In Hose (see p. 15, Table 8)
38	14430	Cable/Water Hose Coupling
39	14803	Clamp
40		Cable/Hose Protector

WATER-COOLED CURVED GUN - PARTS **MODEL HTC-A (Threaded Tip)**

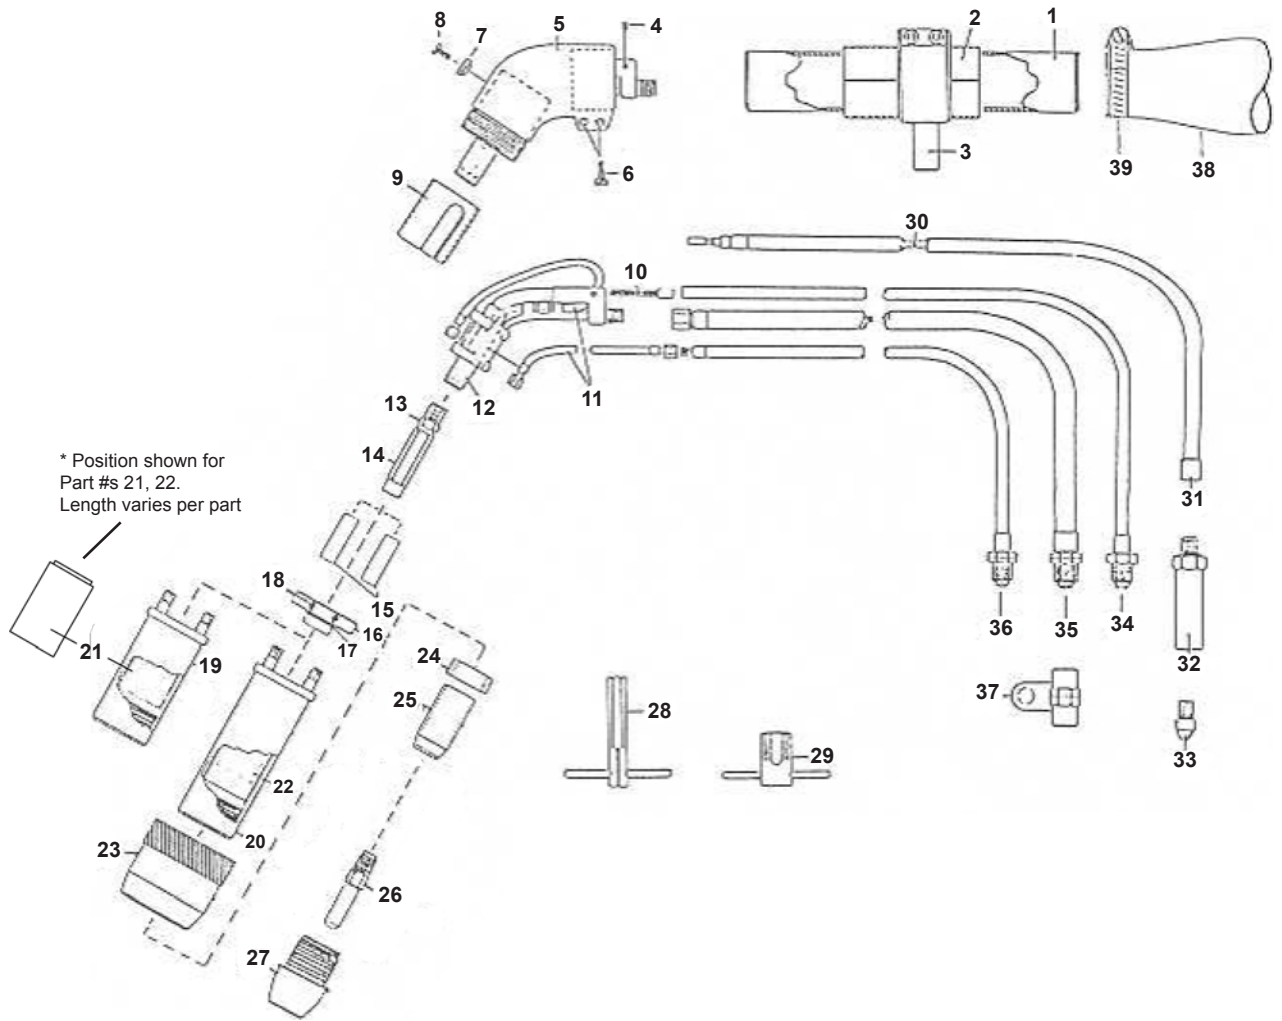

REF.	CODE NO.	DESCRIPTION
1	16744	Body Tube
2	16230	Sleeve
3	14085	Mounting Bracket
4	14712	Socket Screw
5	12885	Body Elbow
6	12521	Socket Screw (2 req'd)
7	12880	Washer
8	12613	Flat Head Screw
9	12892	Elbow Insulator
10		Body Liner (see p. 12, Table 5)
11	10974	Hose Assembly (2 req'd)
12	11035	Inner Body
13	11960	Jam Nut
14	12027	Adapter - 3" Nozzle
	12028	Adapter - 4" Nozzle
15	10723	Insulating Tube (2 req'd)
16	18070	Insulating Collar w/ O-rings
17	12516	O-ring - External
18	13912	O-ring - Internal
19	11142	Water-Cooled Nozzle A3"
20	11138	Water-Cooled Nozzle A4"

REF.	CODE NO.	DESCRIPTION
21	18451	Insulation Tube - 3" Nozzle
22	18452	Insulation Tube - 4" Nozzle
23	16812	Nut
24	18253	Spatter Disc
25	18251	Support Tube - 3" Nozzle
	18252	Support Tube - 4" Nozzle
26		Current Tip - Th'd (see p. 12, Table 4)
27		Gas Nozzle (see p. 5, Table 2)
28	12111	Wrench
29	14614	Nozzle Thread Chaser Tap
30		Liner (see p. 15, Table 6)
31		Casing (see p. 15, Table 7)
32		Wire Feeder Adapter (see p. 17)
33		Inlet (see p. 17)
34		Gas Hose (see p. 15, Table 8)
35		Water Out & Power Cable (see p. 15, Table 8)
36		Water In Hose (see p. 15, Table 8)
37	14430	Cable/Water Hose Coupling
38		Cable/Hose Protector
39	14803	Clamp

TABLE 6 - LINERS

Description	Wire Size	2 Ft.	3 Ft.	4 Ft.	5 Ft.	6 Ft.	7 Ft.	8 Ft.	10 Ft.	12 Ft.	15 Ft.
Hard	.030"	-	14130	14131	14132	16818	16819	16820	12320	12321	12322
Hard/Cored	.035"-.045" **	16443	16444	16445	16446	16447	16448	16449	16407	16408	16409
Hard/Cored	.045"-1/16" **	16147	16148	16149	16150	16151	16152	16153	16119	16120	16121
Stainless	.035"-.045" **	16154	16155	16156	16157	16158	16159	16160	12336	12337	12338
Stainless	.045"-1/16" **	16501	16502	16503	16504	16505	16506	16507	16508	16509	16510
Aluminum	3/64" **	16833	14146	14148	14150	16618	16619	12410	12411	12412	12413
Aluminum	1/16" **	16834	14152	14154	14156	14164	16620	12401	12402	12416	12404
Aluminum	3/32" **	16835	14158	14160	14162	14165	16769	16602	16602	12417	12426

** Liners to be used with double asterisk casing

TABLE 7 - CASINGS

Description	Wire Size	2 Ft.	3 Ft.	4 Ft.	5 Ft.	6 Ft.	7 Ft.	8 Ft.	10 Ft.	12 Ft.	15 Ft.
Casing Assembly (Flexible)											
Select Liner	.030"	14440	14441	14442	14443	12291	12292	12285	12286	12287	12290
Select Liner	.035"-1/16" **	14444	14445	14446	14447	16173	16561	13565	13751	13757	13752
Casing Assembly (Reinforced)											
Single Piece	.035"-.045"	16735	16736	16737	16738	16739	16740	16512	15988	15991	16055
Single Piece	.045"-1/16"	15750	15751	15752	15753	15754	15755	16513	12380	12383	12386
Single Piece	5/64"-3/32"	15729	15730	15731	15732	15733	15734	15735	12441	12449	12443
Single Piece	7/64"-1/8"	15740	15741	15742	15743	15744	15745	16515	12445	12448	12446

** Liners to be used with double asterisk casing

TABLE 8 - UTILITIES

DESCRIPTION	CODE NO. FOR AVAILABLE LENGTHS						
	5 FT.	6 FT.	7 FT.	8 FT.	10 FT.	12 FT.	15 FT.
Gas Hose Assembly	17050	17051	16742	16767	11848	11849	11850
Water In Hose Assembly	18049	13702	16743	11875	12944	12946	12945
Water Out & Power Cable	14453	13733	16580	11905	11906	11910	11908
Cable/Hose Protector	16952	16953	16954	16955	16957	16959	16962





UTILITY STATION - STANDARD

ORDERING INFORMATION

Description	Code No.
Utility Station	45196
Utility Station - Dual Power Cable	45188

DIMENSION SPECIFICATIONS

Base Length	3.75"
Overall Length	5.75"
Base Width	2.25"
Overall Width	2.5"
Overall Height	3.125"
Mounting Hole Center Distance	2.75"
Overall Weight	3.5 lbs.

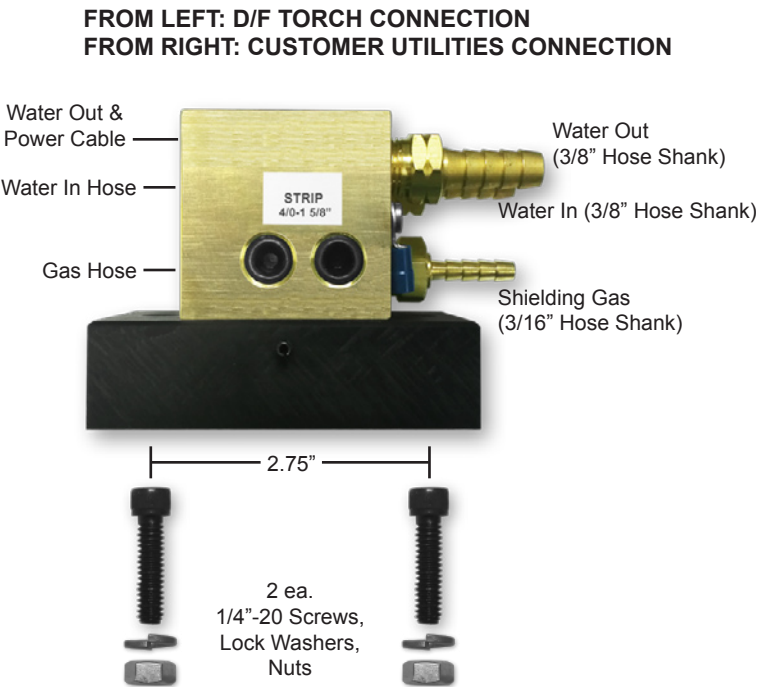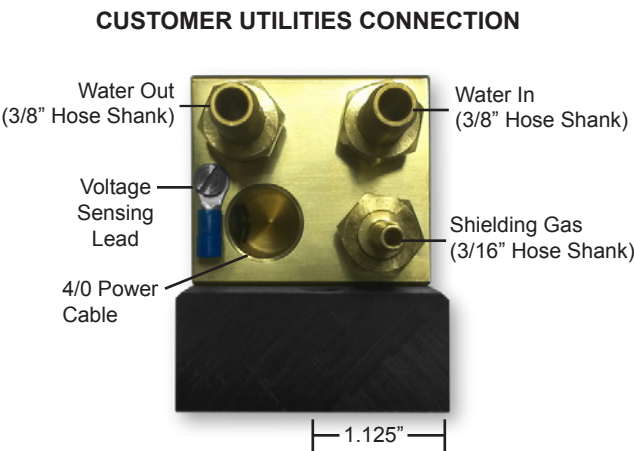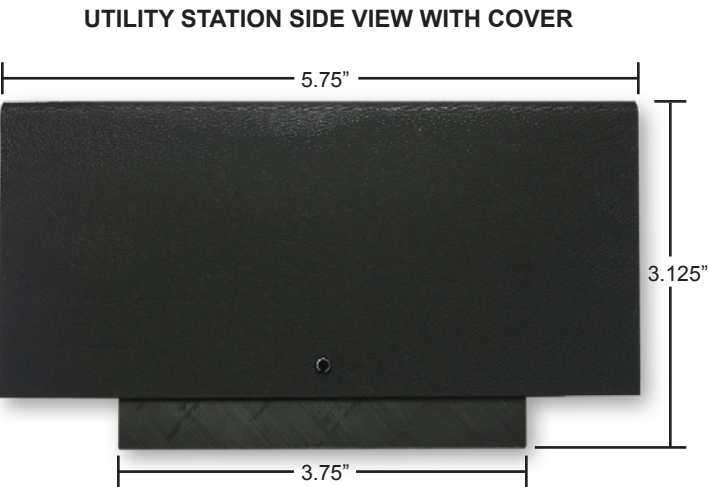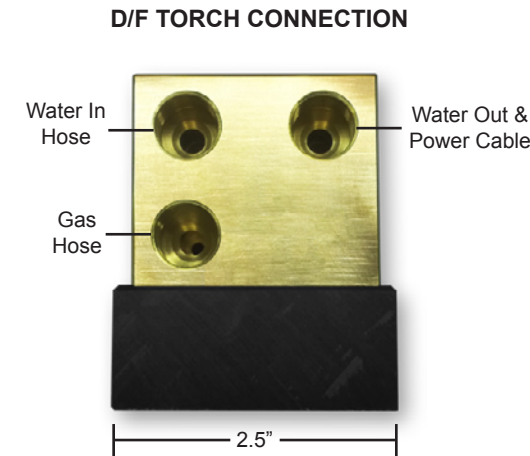

WIRE FEEDER ADAPTERS & INLETS

Manufacturer	Models	Wire Diameter	Remote Mount Adapter			Direct Mount Adapter	
			Hard or AL	Cored	Stub* Liner	Hard or AL	Cored
ESAB®	D20 (20mm)	.030"-3/32" H/C/AL 5/64"-1/8" H/C	13098	13099	*	13096	13097
ESAB®			18246	18247		18248	18249
EURO			18493	18493		18540	18540
Hobart®	All Models	.030"-3/32" H/C/AL 5/64"-1/8" H/C	13067	16087	*	13068	16225
Lincoln®	LN-7, LN-8, NA5-R	.030"-3/32" H/C/AL 5/64"-1/8" H/C	13110	13112	*	13113	13116
	LN-9	.030"-3/32" H/C/AL 5/64"-1/8" H/C	16581	16582	*	16528	16529
	NA3, NA5	.030"-3/32" H/C/AL 5/64"-1/8" H/C	16879	16878	*	16880	16881
"BIG MIG"	NA3, NA5	.030"-3/32" H/C/AL 5/64"-1/8" H/C	16879	16878	*	16888	16888
Lincoln®	Power-Feed 10, LF-72, LF-74	.030"-3/32" H/C/AL 5/64"-1/8" H/C	13479	13469	*	13480	13468
Linde®	SWM31 SWM34 SWM37 SWM38 EH8	Casing to Feeder (Accepts Linde® Outlet Guide)	13046			13046	
		D/F Insert .035"-.045" Hard .045"-1/16" Hard 5/64"-3/32" Cored 3/64"-1/16" AL	13047 13048 13050	13049		13047 13048 13050	13049
	EH10	.030"-3/32" H/C/AL 5/64"-1/8" H/C	13043	13052	*	13080	13079
					*		
Mavrix®	PA-10	.030"-3/32" H/C/AL 5/64"-1/8" H/C	16556	16568	Requires Inlet		
Miller® (50 Series)		.030"-3/32" H/C/AL 5/64"-1/8" H/C	16557	16559	*	16558	16560
OTC®	Requires Insert	.030"-1/8" .030"-1/8"	18268		*	18275	
	CMRE-741		18282			18282	
Panasonic®	PME-12X YW50AKW1	.030"-1/16" .030"-1/16"	13090 13466	Requires Inlet			
TWECO®	#4	.030"-3/32" H/C/AL 5/64"-1/8" H/C	13479	13469	*	13480	13468
Welding Alloys®		.030"-3/32" H/C/AL 5/64"-1/8" H/C		Requires Liner Requires Inlet		13486	13486

*Stub liners only required in feeder adapter when single-piece casing is used.

ORDERING INFORMATION

Each D/F gun is fully assembled and ready to install. In order to make the installation complete, the code number, wire size & type, make/model of wire feeder, and inlet as needed must be specified when ordering. If special welding tools or accessories other than those listed previously are required, please consult with the factory.

FEEDER ADAPTER INLETS

Wire Size	Steel Code No.	Brass Code No.	Nylon Code No.
.030"	13801	16417	
.035"	13803	16418	
.045"	13806	16419	
.052"	13844	16420	
1/16"	13809	16421	
5/64"	13812	16422	
3/32"	13814	16422	
7/64"	13816		
1/8"	13842		
3/64" AL			13807
1/16" AL			13810
3/32" AL			13815

Esab®, Hobart®, Lincoln®, Linde®, Miller®, OTC®, Panasonic®, ABB®, Fanuc®, Kuka®, Mavrix®, Motoman®, Thermal Arc®, TWECO®, & Welding Alloys® are registered trademarks of their respective companies. Names are mentioned for reference only. D/F Machine Specialties is in no way affiliated with these companies.

TROUBLESHOOTING: POROSITY (SUMMARY)

NOTE: Most POROSITY is caused by gas problems, followed by base metal contamination.

Causes of Porosity

BASE METAL CONTAMINATION

Impurities on base metal

FILLER METAL CONTAMINATION

Impurities on filler metal (wire)

ATMOSPHERIC CONTAMINATION

Drafts, wind, fans, etc.

GAS MIXING APPARATUS

1. Too high a gas flow, causing turbulence, and/or sucking air at hose connections; creating the venturi effect at end of gas nozzle
2. Too low a gas flow, causing insufficient gas coverage
3. Damaged or kinked gas lines
4. Too high an oxygen content
5. Leaks in gas distribution system
6. Other impurities in gas - moisture, etc.
7. Inconsistent gas flow (cfh) at the torch connection

GAS TURBULENCE

1. Excessive spatter build-up in gas nozzle and on current tip
2. Nozzle damage, causing uneven gas coverage
3. Torch gas ports clogged or deformed
4. Super-heated nozzle, causing shielding gas to expand rapidly and create return effect at end of nozzle
5. Gas diffuser/nozzle insulator missing
6. Too high a gas flow causing the venturi effect

WELDING PARAMETERS, ETC.

1. Too long a wire stick-out; gas nozzle too far from weld puddle
2. Bad torch position - too sharp a torch incline causing the venturi effect at the end of the nozzle leading to atmospheric contamination
3. Excessively wide weld pool for nozzle I.D.
4. Arc voltage too high
5. Too high a travel speed

Possible Solutions

- a. Remove contamination; clean surfaces
- b. Use of specific wire/gas mix for specific types of impurities

- a. Replace wire
- b. Install wire-cleaning system
- c. Prevent industrial dust/dirt/grit from contaminating wire during storage or use
- d. Prevent build-up of aluminum oxide on exposed aluminum wire surface by using up quickly
- e. Remove wire from wire drive unit and store in a sealed plastic bag when not in use for long periods

- a. Protect weld from drafts (curtains/screens)
- b. Use tapered or bottleneck gas nozzles when drafts cannot be avoided

- 1a. Reduce gas flow
- 1b. Tighten all hose connection points
2. Increase gas flow
3. Repair or replace
4. Adjust mixer
5. Repair leaks
6. Overhaul system; fit filters and/or dryers
7. Regulate pressure into flow meter for consistent cfh delivery of gas

1. Clean nozzle and tip regularly; spray with anti-spatter fluid
2. Replace nozzle
3. Clean or replace
4. Check duty cycle rating of torch
5. Replace
6. Reduce gas flow

1. Use longer nozzle or adjust stick-out (3/8" minimum or 15 times wire diameter)
2. Correct torch angle
3. Width of the weld pool should be 1.3 times the nozzle I.D.; use suitable wider gas nozzle
4. Reduce voltage
5. Reduce speed

TROUBLESHOOTING: SPATTER

Problems/Causes

SPATTER

Too fast or too slow wire feed for the arc voltage

Too long an arc

Damaged current tip

Inclination of welding gun too great

Faulty power source

Incorrect start

Incorrect pulse parameters

Uneven wire feed

Impurities on the base metal

Poor ground contact

Too long stick-out (short-arc welding)

Incorrect polarity

Possible Solutions

Set the wire feed rate and voltage in accordance with good welding practices as recommended by a qualified welding engineer.

Adjust the wire feed and voltage so that the arc is in accordance with good welding practice for the joint to be welded. The distance from the current tip to the workpiece should be 15 times the welding wire diameter. If the arc is too long there will be spatter, usually in the direction of the weld.

If the current tip becomes worn the welding wire will not be in constant contact with the tip and the arc will become unstable. A current tip contaminated with spatter will cause uneven wire feed resulting in further spatter.

The angle of the gas nozzle relative to the workpiece should be between 45 and 90 degrees. If the angle is too small, the wire runs parallel to the weld pool, resulting in spatter in the direction of the welding.

Have the power source checked for faulty conditions such as broken wires and faulty contacts.

A great deal of spatter occurs if the stick-out is too great and if the welding gun is held too far from the workpiece when striking the arc. Try to start with as short a stick-out as possible and with the welding gun as close to the starting point as possible. If a large ball end is formed on the end of the welding wire, remove it by cutting the wire with sharp wire cutters. It is helpful if the wire is cut to a point. Always remove the ball end before striking an aluminum arc. Check the welding ground connection.

Check the user manual for your power supply or consult a qualified welding engineer.

Uneven wire feed gives rise to heavy spatter. Find the cause of the disturbance and correct the condition before proceeding.

Paint, mill scale, rust and other contamination on the base metal form an insulating layer causing an unstable arc that results in heavy spatter. Clean the surfaces to be welded.

Inspect ground cable for loose connections, fraying and cuts. Correct any problem areas found and attach the ground cable directly to the workpiece after having cleaned the contact surface first. POOR GROUND CONTACT IS THE MOST COMMON CAUSE OF UNSTABLE MIG WELDING CONDITIONS.

The stick-out should be 15 times the diameter of the wire electrode being used. With increasing stick-out, the current is reduced and the arc voltage rises, giving a longer unstable arc and increased spatter.

Check for correct polarity. Follow the electrode manufacturer's recommendations.

TROUBLESHOOTING: GENERAL GUIDE

Problems/Causes

Possible Solutions

ERRATIC WIRE FEED

Slipping feed rolls

Check that the feed roll size is correct for the wire size being used. Increase the drive roll pressure until the wire feed is even. Do not apply excessive pressure as this can damage the wire surface, causing copper coating to loosen from steel wires or metal shavings to be formed from soft wires like aluminum. These metal fragments or shavings can be drawn into the wire feed conduit and will rapidly clog the liner. When welding with flux-cored wires, excessive drive roll pressure may open the wire seam and allow flux or metal powders to escape.

Clogged or worn gun liner

a. Dust, particles of copper, drawing lubricants, metal or flux and other forms of contamination can all clog the liner so that the wire feed is slowed or impeded. A liner that has been in use for an extended period of time becomes worn and filled with dirt and must be replaced.

b. When changing the welding wire, remove the tip from the front end of the gun and blow out the body liner with clean, dry compressed air from the back of the gun. Repeat with the casing and liner assembly. Note: Wear safety goggles when using compressed air to clean the liners. Make sure proper safety procedures are followed in order to avoid possible serious eye injury.

Liners too long or too short

Check the lengths of the liners and trim or replace if too long or too short. The efficient feeding of the welding wire is dependent on the liners fitting correctly.

Spatter on the wire

An unprotected coil of wire quickly collects dust and other airborne contamination. If grinding is being performed in the vicinity, particles can become attached to the wire, severely interfering with the wire feed. Replace with clean wire and keep it protected with a cover. Make sure spare wire rolls are stored in a clean, dry place.

Coil brake incorrectly adjusted

Set the brake so that the coil immediately stops rotating as soon as welding is interrupted. If the brake is applied too hard it will cause the feed rolls to slip, resulting in uneven wire feed. If it is too loose, overrun of the wire will occur, causing wire tangles, inconsistent tension on the feed mechanism and irregular arc characteristics.

UNSTABLE ARC

Incorrect setting of voltage and/or current

Set the wire feed in relation to the arc voltage in such a way that the arc is stable and burns evenly. In spray arc welding, set the wire feed so that there are no short circuits and the filler metal is transferred in a spray across the arc. Find the cause of the interference and correct it. (See ERRATIC WIRE FEED above)

Problems in wire feeding: worn current tip

When the internal diameter of the current tip becomes worn from the passage of wire through it, the wire may no longer stay in continuous electrical contact with the tip. This results in an unstable arc and an increase in spatter. Paint, mill scale, silicon scale, rust or flux deposits from previous weld runs may form an insulating layer causing an unstable arc. Clean the surfaces to be welded.

Impurities on the base metal

Securely attach the ground cable as close to the point of welding as possible on the workpiece. Clean the surfaces thoroughly to ensure good contact.

Poor contact between ground cable and work-piece or loose power connection

Check to insure the welding power connection on the power source is tight, the and workpiece. Connection on the wire feeder is tight, the connection to the adaptor block is tight, Loose power connection and the connection of the gun to the adaptor block is tight.

Stick-out too long

Adjust the current tip to work distance to a minimum of 3/8" for short arc welding. A more precise distance is 15 times the wire diameter.

TROUBLESHOOTING: GENERAL GUIDE

Problems/Causes

Possible Solutions

AIR-COOLED GUN RUNNING TOO HOT

Poor ground

Inspect ground cable for loose connections, fraying and cuts. Correct any problem areas found. Clean clamping area to insure good contact. Securely attach the ground cable to the workpiece, as close as possible to the point of welding. Make sure there is a good connection to the welding power source.

Loose power connection

Check to make sure the power connection on the power source is tight, the connection on the wire feeder is tight, the connection to the adaptor block is tight, and the connection of the gun to the adaptor block is tight.

Consumable items loose or worn

Remove nozzle from gun and inspect current tip, collet nut (tip holder) and spatter disc (gas diffuser) for wear and tightness; replace or tighten as necessary.

Capacity of gun being exceeded

Note complete weld parameters, including welding current (Amps), welding voltage, wire feed speed, type and size of wire, type of gas and flow rate of gas and consult your local Authorized D/F Machine Specialties Distributor or contact the factory.

Dirty connection

Remove torch and inspect parts for dirt build-up. Periodic cleaning is necessary.

D/F MACHINE SPECIALTIES, INC.

MIG & TIG Welding Products, Consumables & Accessories

WARRANTY

This Equipment is sold by D/F MACHINE SPECIALTIES, Incorporated, under the warranty set forth in the following paragraph. Such warranty is extended only to the buyer who purchases the equipment directly from D/F or its authorized distributor as new merchandise.

The barrel and cable assemblies are warranted by D/F to be free from manufacturing defects for 90 days after delivery by D/F, provided that the equipment is properly operated under conditions of normal use and that regular periodic maintenance and service is performed. Expendable parts are not warranted for any specific time. Expendable parts referred to herein would be the nozzles, current tips, spatter discs, insulators, casing liners, and wire inlets. D/F's sole obligation under this warranty is limited to making replacement at its manufacturing facility for barrel assemblies which are returned to it with transportation charges prepaid, and upon D/F's examination have been found to be so defective.

Genuine D/F MACHINE SPECIALTIES, Inc. Parts, Accessories, and Consumables must be used for safety and performance reasons. The use of anything other than genuine D/F MACHINE SPECIALTIES, Inc. Parts, Accessories, or Consumables will void this Warranty. All units returned for warranty repair are subject to Warranty Inspection. Warranty and repair work shall not apply to goods that have been altered or repaired, have been subject to misuse or used while any parts are loose, broken, or damaged, or used with other than original D/F® parts, consumables, or accessories which may affect performance and safety.



Rev. 140612-2

D/F MACHINE SPECIALTIES, INC.

1750 Howard Drive

North Mankato, MN 56003

Phone: (507) 625-6200

Fax: (507) 625-6203

www.dfmachinespecialties.com